


KGPparts.com

Injector p/n 53030282	Vehicle Dodge Dakota		Customer Name:					
	Year 1994		XXXXXXXXXXXXXXXXXX					
	Engine 5.2 V8		Date:					
	Injector #							
Test	1	2	3	4	5	6	7	8
Resistance ohms								
Leak Test Before	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass
Pass / Fail After	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass
Spray Pattern Before	Fair	Good	Fair	Fair	Fair	Fair	Fair	Fair
Spray Pattern After	Good	Good	Good	Good	Good	Good	Good	Good
Static Flow Before	312	308	312	312	316	312	308	312
Static Flow After	312	312	312	312	312	312	308	308
15 sec @ 3 Bar	78	77	76	77	79	79	77	78
cc/min @ 3 Bar	312	312	312	312	312	308	308	308

EXAMPLE

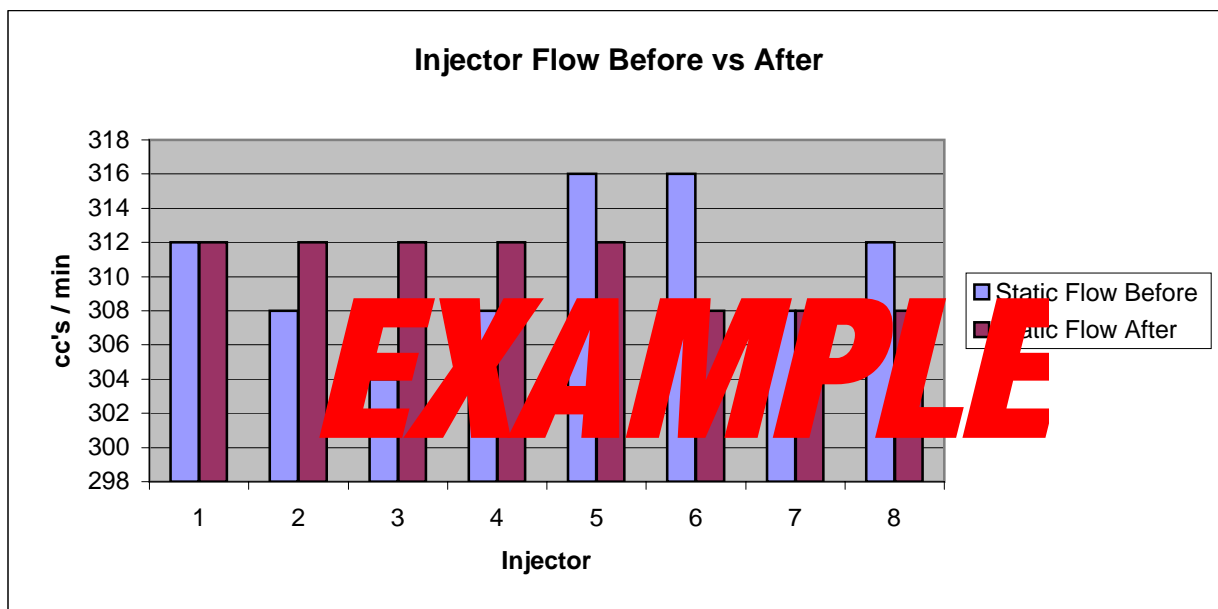

*Largest Variance Before 3.797%

*Largest Variance After 1.282%

**Acceptable System Balance < 2%